



Model LT

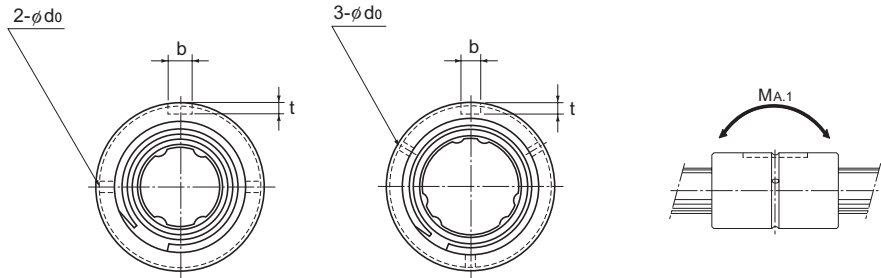

Model LT13 or smaller

Model LT16 or greater

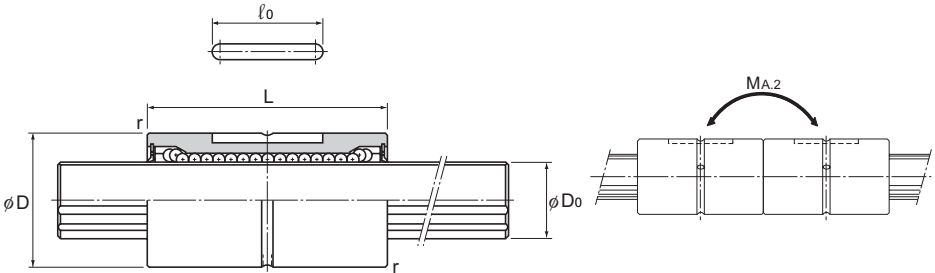

Model No.	Spline nut dimensions									Spline shaft diameter D ₀ h7	Rows of balls	Basic torque rating		Basic Load Rating		Static permissible moment		Mass	
	Outer diameter		Length		b H8	Keyway dimensions		r	Greasing hole d ₀			C _T N·m	C _{OT} N·m	C kN	C ₀ kN	M _{A.1} ** N·m	M _{A.2} ** N·m	Spline Nut g	Spline shaft kg/m
	D	Tolerance	L	Tolerance		t +0.05 0	ℓ ₀												
Note) LT 4	10	0 −0.009	16	0 −0.2	2	1.2	6	0.5	—	4	4	0.59	0.78	0.44	0.61	0.88	6.4	5.2	0.1
Note) LT 5	12	0 −0.011	20		2.5	1.2	8	0.5	—	5	4	0.88	1.37	0.66	0.88	1.5	11.6	9.1	0.15
LT 6	14		25		2.5	1.2	10.5	0.5	1	6	4	0.98	1.96	1.18	2.16	4.9	36.3	17	0.23
LT 8	16		25		2.5	1.2	10.5	0.5	1.5	8	4	1.96	2.94	1.47	2.55	5.9	44.1	18	0.4
LT 10	21	0 −0.013	33		3	1.5	13	0.5	1.5	10	4	3.92	7.84	2.84	4.9	15.7	98	50	0.62
LT 13	24		36	3	1.5	15	0.5	1.5	13	4	5.88	10.8	3.53	5.78	19.6	138	55	1.1	
○ LT 16	31	0 −0.016	50	0 −0.3	3.5	2	17.5	0.5	2	16	6	31.4	34.3	7.06	12.6	67.6	393	165	1.6
○ LT 20	35		63		4	2.5	29	0.5	2	20	6	56.9	55.9	10.2	17.8	118	700	225	2.5
○ LT 25	42		71		4	2.5	36	0.5	3	25	6	105	103	15.2	25.8	210	1140	335	3.9
○ LT 30	47	80	4		2.5	42	0.5	3	30	6	171	148	20.5	34	290	1710	375	5.6	
○ LT 40	64	0	100		6	3.5	52	0.5	4	40	6	419	377	37.8	60.5	687	3760	1000	9.9
○ LT 50	80	−0.019	125	0 −0.4	8	4	58	1	4	50	6	842	769	60.9	94.5	1340	7350	1950	15.5
○ LT 60	90	0	140		12	5	67	1	5	60	6	1220	1040	73.5	111.7	1600	9990	2500	22.3
○ LT 80	120	−0.022	160		16	6	76	2	5	80	6	2310	1920	104.9	154.8	2510	16000	4680	39.6
○ LT 100	150	0 −0.025	185		20	7	110	2.5	5	100	6	3730	3010	136.2	195	3400	24000	9550	61.8

Note) Models LT4 and 5 do not have a retainer. Do not remove the shaft from the spline nut. (It will cause balls to fall off.)
○ : indicates model numbers for which high temperature types are available (with metal retainer; service temperature: up to 100°C).

(Example) LT20 A CL+500L H
└──────── High temperature symbol

Model number coding

2 LT30 UU CL +500L H K

Model No. Symbol for clearance in the rotational direction (*2) Accuracy symbol (*3) Symbol for standard hollow spline shaft (*4)

Number of spline nuts on one shaft (no symbol for one nut) Contamination protection accessory symbol (*1) Overall spline shaft length (in mm)

(*1) See A-509. (*2) See A-481. (*3) See A-482. (*4) See B-391.

Note) **M_{A.1} indicates the permissible moment value in the axial direction when a single spline nut is used, as shown in the figure above.
**M_{A.2} indicates the permissible moment value in the axial direction when two spline nuts in close contact with each other are used, as shown in the figure above.
(Single LT-unit configuration is not stable in accuracy. We recommend using two units in close contact with each other.)
For details on the maximum lengths of ball spline shafts by accuracy, please see B-410.